

# *Field Software Notice*

To: **Conventional Systems Users**  
Subject: **Software Release**

---

Platform: **2600 Repeater**  
Protocol: **Conventional**  
Version Release #: **2.6.8**  
Supersedes Version#: **1.26.4/2.6.5**  
Effective Release: **June 21, 2007**

---

## **Comments:**

**The following update from repeater software version 1.x to 2.6.8 is only required if the repeater is having transmitter lockup problems. If your system is operating properly, you do not need to install software version 2.6.8.**


Before updating a 2600 repeater from version 1.x to version 2.6.8 verify that the controller card has all the ECOs (Engineering Change Orders) required bringing it up to Revision 5, or that a Revision 5 board is currently installed in the repeater. During development of version 2.x.x 2600 software, problems with repeater lock-ups and the inability to program flash were traced to contention between the DSP and Power PC for a shared memory buss line. On updated controller boards, traces should have been cut to remedy the contention problem. If the traces have not been cut, the controller board needs to be swapped out with a current Revision 5 board. **Old boards need to be returned to EFJohnson's Repair Depot for rework.**

**The pictures on the following page depict the locations for rework.**

**If you have any questions about this Field Software Notice, please call EFJohnson's Technical Support group at 1-800-328-3911 ext 3.**


## *Field Software Notice*

Verify traces are cut.

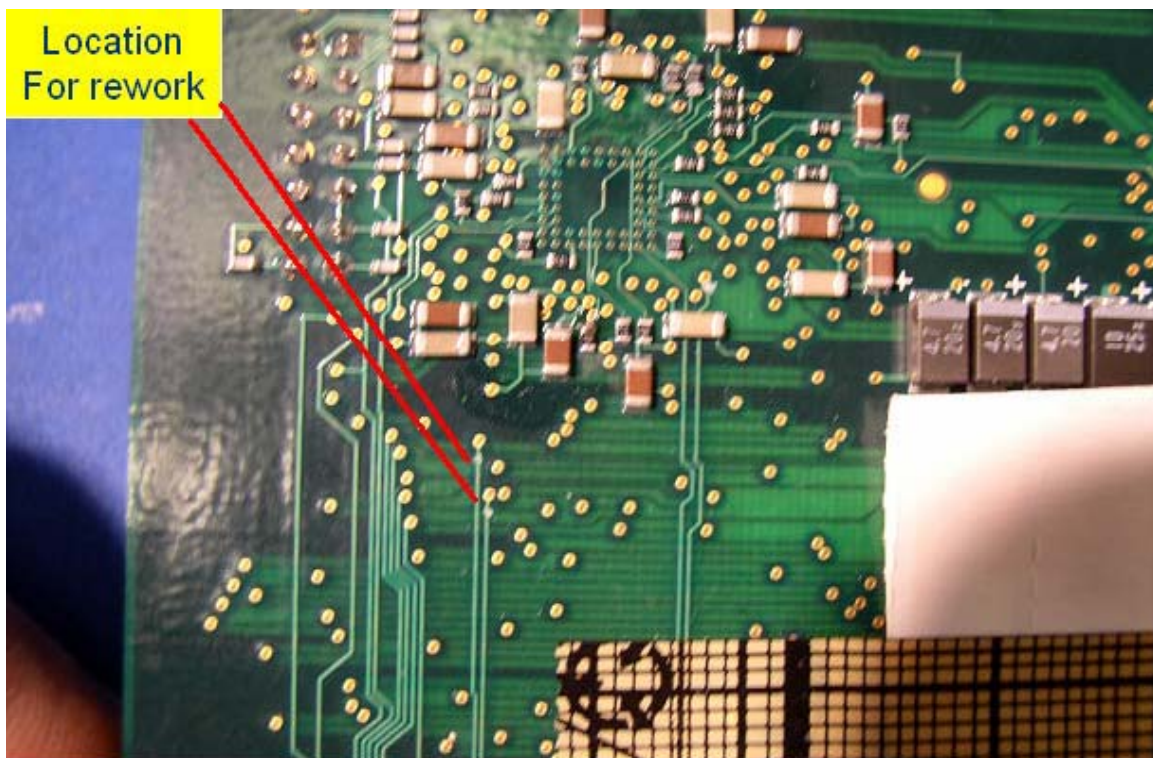

# *Field Software Notice*

Verify traces are cut.

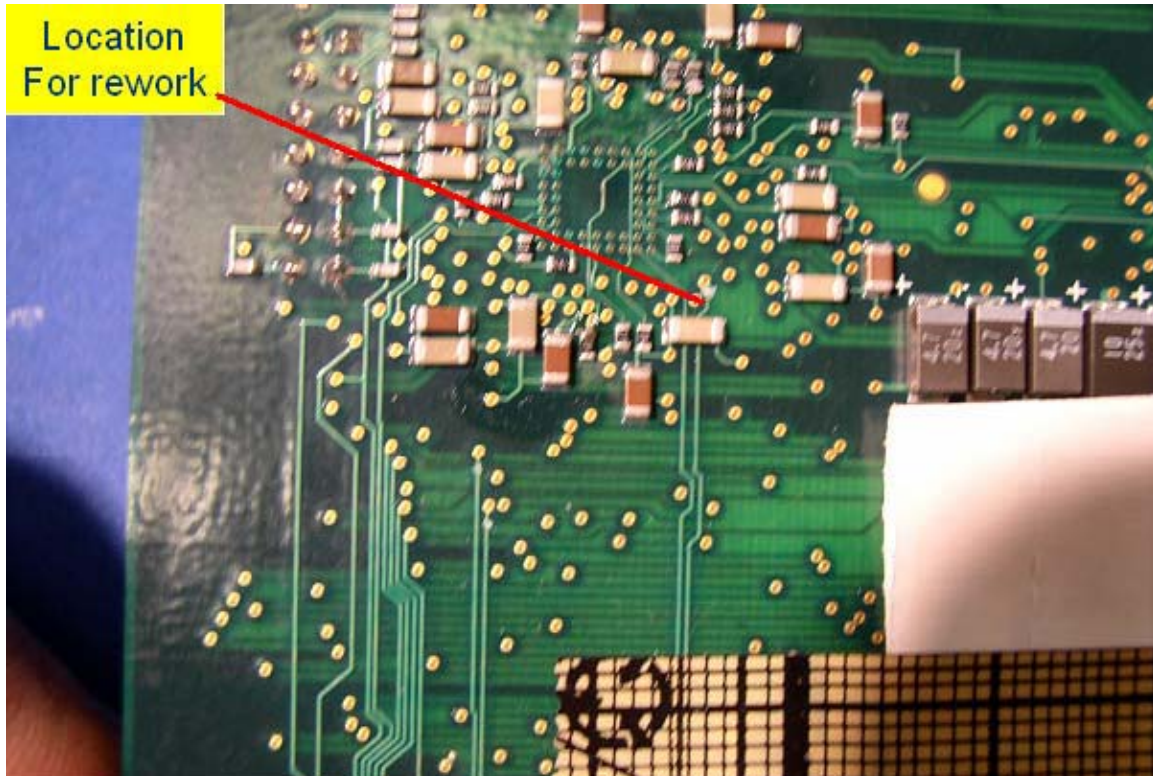

# *Field Software Notice*

Verify traces are cut.

